Documented	Mileage	Date	Description of Work	Performed by	Notes
$\checkmark$	2,804	4/25/2007	Took Possession Performed 5k Service as acceptance	Owner	
<b>✓</b>	5,032	5/30/2007	5K Service; BAS Recall	Dealer	Cycle Stop, Inc. 2600 W. Henrietta Road Rochester NY 14623 Phone: 585-424-2120 Fax: 585-424-1355
$\checkmark$	5,975	6/20/2007	Tires: Michelin Pilot Roads F:120/70ZR17 R: 180/55ZR17	Owner	
lacksquare		8/1/2007	Interim Service: Motor: Lube /Oil / Filter Primary: Changed Oil	Owner	
$\checkmark$	10,230	10/24/2007	10K Service; Post Service Checklist	Owner	Post Service Fastener Loctite Application & Torque Validation

Documented	Mileage	Date	Description of Work	Performed by	Notes
<b>✓</b>	12,320	4/1/2008	Tires: Michelin Pilot Roads F:120/70ZR17 R: 180/55ZR17  Brake Pads: F: Lyndalls Gold Flushed Brake Lines Installed Touratech Handguard Extensions Installed Presision Engineering Handlebar Risers	wner/Dealer	2008 Pre-Season: Over-Adjusted Clutch fixed @ Dealer Cycle Stop, Inc. 2600 W. Henrietta Road Rochester NY 14623 Phone: 585-424-2120 Fax: 585-424-1355
	15,230	5/25/2008	Tires:  Metzler ME880  F:120/7600ZR17  R: 180/55ZR17  Brake Pads: R: Buell OEM  Installed Touratech Handguard Extensions Installed Presision Engineering Handlebar Risers	Owner	
	16,800	8/2/2008	Minor "OFF" Documented Here	Owner	http://advrider.com/forums/showpost.php?p=7575163&postcount=7
	17,500	9/1/2008	Interim Service: Motor: Lube /Oil / Filter Primary: Changed Oil	Owner	

Documented	Mileage	Date	Description of Work	Performed by	Notes
<b>✓</b>	20,129	10/16/2008	20K Service; Fan Recall Intermittant Short circuit causing complete Engine Shutdown (Not Resolved) Post Service Checklist	Dealer	Post Service Fastener Loctite Application & Torque Validation Cycle Stop, Inc. 2600 W. Henrietta Road Rochester NY 14623 Phone: 585-424-2120 Fax: 585-424-1355
<b>✓</b>	20,355	4/1/2009	Replaced Voltage Regulator Replaced "77" Connector Installed: Auxillary Fuse Panel w/ Relay Separate HD Wiring Added Breather Modification & Separate Catch Can H.I.D. Low & High Beam in new Light housing H.I.D Auxillary Lights (Hella FF50 Housing) BMW Power Port Iron Machine Spark Plug Wires K&N Air Filter HD Heated Grips	Owner	
<b>✓</b>	22,000	5009	Pre-Trip KY CheckList: Motor: Lube /Oil / Filter Primary: Changed Oil Cleaned K&N Air Filter Metzler ME880 R: 180/55ZR17	Owner	

Documented	Mileage	Date	Description of Work	Performed by	Notes
	23,702	9/2009	Oil Leak on R/S of Bike. Intermittant failure Speedometer/Odometer Rear Brake Grinding noise (Changed Rear Pads - Rotor Not in Stock - Rode Home)	Jealer	Smokey Mountain H-D Buell 1620 W. Lamar Alexander Hghy Maryville, TN 37801 865-977-1669
	24,589	7/6/2009	Drive Belt Side Rear Wheel Bearing Failure.		
<b>✓</b>			Replace both Front Wheel Bearings Replace both Rear Wheel Bearings Replace Front Brake Pads (Lyndalls Gold) Replace Rear Brake Pads (HD) Replace Rear Rotor (Bild) Rebuild Rear Brake Master Cylinder	Owner	
	-/+ 0002	8/19/2009	Drive Belt Failure; Towed Home		

Documented	Mileage	Date	Description of Work	Performed by	Notes
	25,235	9/17/2009 - 3/10/2010	Requested Service: 25K Service Replace Oil in Front Shock Install New Drive Belt Repair Clutch Cable Oil Leak Fan Recall (Previous Warranty Work) Bad Speed Sensor Intermittant Fault Comfort Kit (R/S Scoop & ECM Re-flash to new Map)	Dealer	Cycle Stop, Inc. 2600 W. Henrietta Road Rochester NY 14623 Phone: 585-424-2120 Fax: 585-424-1355 Was called on 10/27 to Pick-Up Bike. Attempted to Pick-up on 10/28. Validated New Drive Belt Install Clutch Cable Oil Leak Repair New Fan Installaion (Previous Warranty Work) Work not performed: Bad Speed Sensor not addressed (Repaired in 3/2010 by me) Intermittant Fault While performing pre-trip checks, I start the bike and it runs roughly (more so than usual) and the check Engine light comes on. I refuse acceptance and politly tell the Service writerthat I refuse delivery and Buell/HD will be called with customer complaint. Bike stays @ Dealer all winter; Pick-up on 3/10 with the following work performed: New ECM Cylinders & Piston rings Replaced New Throttle Body & Throttle Body manifold New Throttle Cable New Spark Plugs Comfort Kit (R/S Scoop & ECM Re-flash to new Map) All work covered by HD Extended Warranty.

Documented	Mileage	Date	Description of Work	Performed by	Notes
	25029 (Go Figure)	3/11/2009 - 3/20/20	Oil Leak (Hoses improperly re-routed)	Dealer	Cycle Stop, Inc. 2600 W. Henrietta Road Rochester NY 14623 Phone: 585-424-2120 Fax: 585-424-1355repaired
	26,000	4/1/2010	Replace Rear Speed Sensor	Owner	
<b>√</b>	27,506	/201	Interim Service: Motor: Lube /Oil / Filter Primary: Changed Oil	Owner	
		4/2010 - 7/2010	Riding Limited due to Work Commitment		
		//2010	Informed by Employer that my job was eliminated. Riding Limited due to Work Commitment. Did not ride from 8/2010 - 10/2010 due to loss of employer health insurance coverage.		

Documented	Mileage	Date	Description of Work	Performed by	Notes
		12/1/2010 - 2/1/2011	Accepted new job in California; Relocated household to Las Vegas, NV.	Owner	
		2/1/2010 - 8/1/2010	Limited riding due to job commitment and family/personal issues	Owner	
			Purchased Yamaha Super Tenere as replacement for Buell. Stripped accessories from Buell and returned to partial stock	Owner	
<b>✓</b>	29,560	11	Interim Service: Motor: Lube /Oil / Filter Primary: Changed Oil	Owner	

Documented	Mileage	Date	Description of Work	Performed by	Notes
<b>✓</b>	29,755		Replaced: Front Rotor (Erik Buell Racing) Brake Pads (DP Racing HH+) Front Motor Mount/Isolator, XB Series	Owner	